

## 'Orion Range' Infra-red Motion Detector - Ceiling Slimline Model: OD101

### Important Safety Instructions

- Please read these instructions carefully before installation and keep safe for future reference.

#### IMPORTANT

This product should be installed by a competent person and in accordance with the current IET Wiring Regulations and Building Regulations.

If in doubt, consult a qualified electrician.

- Always turn off the mains supply before commencing work.




This product uses an infra-red heat detector. The detector senses 'warmth movement' in the surrounding area when it is dark. When movement is detected the sensor is activated and triggers the connected load. It has a built in photo-cell that can identify day and night.


### FIELD OF DETECTION



Good Sensitivity

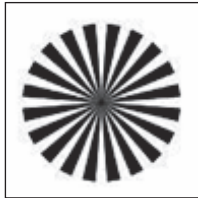

Detection from Above



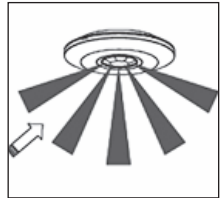


Poor Sensitivity

### INSTALLATION


As the detector responds to changes in temperature, avoid the following situations:-

- Avoid pointing the detector towards objects with highly reflective surfaces, such as mirrors etc.
- Avoid mounting the detector near heat sources, such as heating vents, air conditioning units, lights etc.
- Avoid pointing the detector towards objects that may move in the wind, such as curtains, tall plants etc.

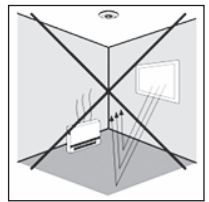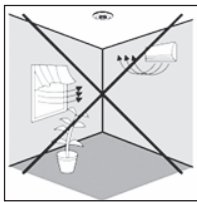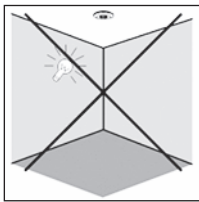


**Switch the mains supply OFF first to prevent electric shock.**

1. Remove the cover by rotating anti-clock wise.
2. Connect the mains in and load out wires according to Dia: 3, using the rear entry or side entry knock-outs as required see Dia:1 and 2.

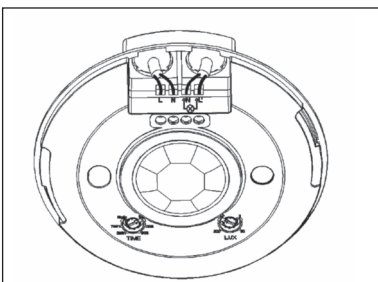


Dia:1 Rear-entry Knockouts

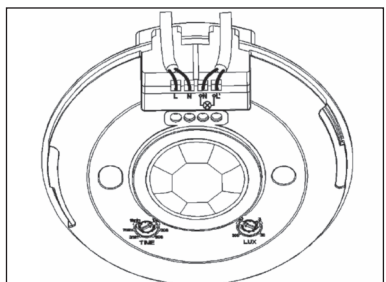


Dia:2 Side-entry Knockouts

- Secure the sensor to the ceiling using two wood screws (ensure there is no wiring/gas/water services directly behind the screws) refer to Dia:4.

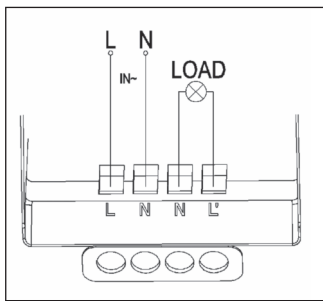


Dia:3

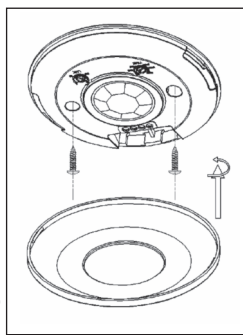

Dia:4

### TESTING

- Turn 'Time' control fully anti-clockwise and 'Lux' control fully clock wise, refer to Dia: 5.

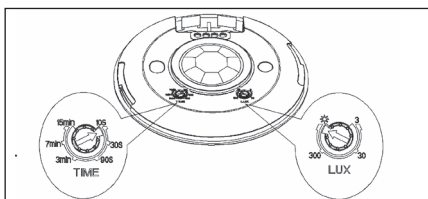

Dia:5

- Re-connect mains supply, allow 30 seconds for the sensor to warm-up, and then perform a walk-by in front of the sensor; lamp should turn on and stay on for approximately 10 seconds, and will go off if no further movement is detected.

### ADJUSTING THE 'LUX' CONTROL

- Turning Lux control fully clock wise, the sensor will operate in both daylight and darkness.
- Turning Lux control fully anti-clockwise, the sensor will operate in darkness only.
- Set control to operate at your required daylight level.

### ADJUSTING THE 'TIME ON' CONTROL

- Turning the time control fully anti-clock wise will set the on duration to 10 seconds +/- 3 seconds.
- Turning the time control fully clock wise will set the on duration to 15 minutes +/- 2 minutes.
- Set control to your required time setting.

### TROUBLE SHOOTING

#### Light not coming on

- Check that lamp is good.
- Check there is nothing obscuring the PIR sensor.

#### Intermittent operation

- Check there are no curtains that can move in the wind.
- Check there are no heating vents nearby.

### TECHNICAL INFORMATION

Rated Voltage:	230V ~ 50Hz
IP Rating:	IP20
Ambient Light:	<3-2,000 LUX (Adj)
Time Delay:	Min 10 sec ± 3 sec Max 15 min ± 2 min
Rated Load:	Max 2000W Max 1000W ⇄ /LED
Detection Range:	360°
Detection Distance:	6M max (<24°C)
Working Temp:	-20° - + 40°C
Working Humidity:	<93%RH
Power Consumption:	0.5W approx
Installation Height:	2.2 - 4M
Detection Moving Speed:	0.6 - 1.5m/s
Dimensions:	115Ømm
Depth -	24.3mm

#### GUARANTEE

Your GreenBrook Motion Detector Slimline OD101 is guaranteed for 1 year from the date of purchase. This is in addition to your statutory rights.

PLEASE KEEP THESE INSTRUCTIONS SAFE FOR FUTURE REFERENCE



EMC

CE

**GREEN BROOK**  
ELECTRICAL  
WEST ROAD . HARLOW  
ESSEX . CM20 2BG . UK  
info@greenbrook.co.uk  
www.greenbrook.co.uk